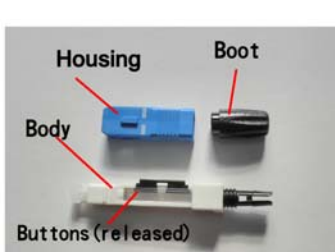

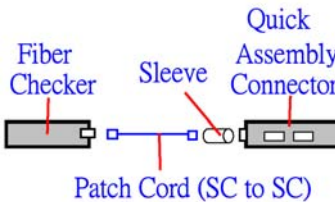
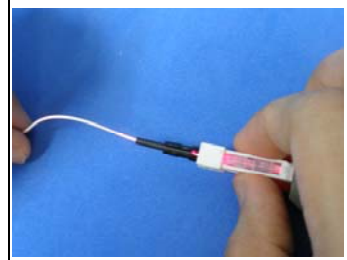

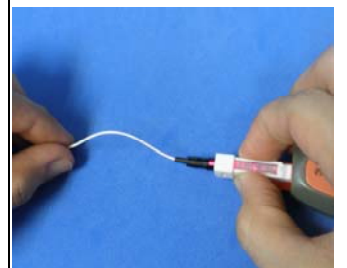
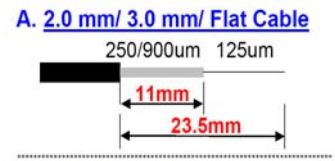
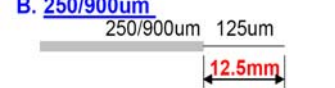

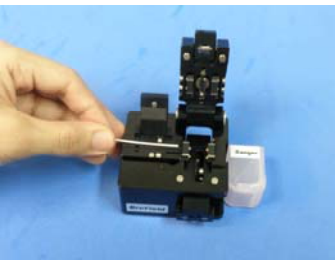



Quick Assembly Connector (No Tool) – 250um/900um User's Manual

Rev. 2011B

A. Instruction for SC - 250um/900um

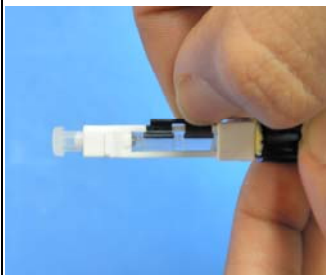
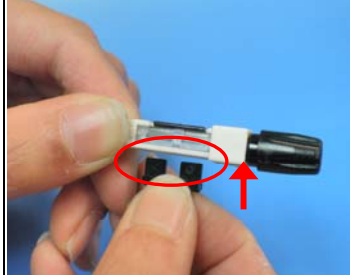
You may set Fiber Checker for the best result. If you don't have it, please skip [Step 1](#) & [Step 7](#).

	<p>< Drawing > Major components.</p> <p>*Please confirm buttons are released before using. Refer to Page 2 for releasing.</p>		<p>Step 4 Insert the tube and fiber to the body.</p> <p>(With Fiber checker, please fine tune the fiber until the red light is weak.)</p>						
	<p>Step 1 Take off dust cap and clean the connector. Then, insert it to Fiber Checker (Patch Cord).*</p> <p>(Skip this if no Fiber Checker.)</p>		<p>Step 5 Form a curve on the fiber.</p>						
	<p>Step 2 Wear boot. Then, wear tube. (No tube for 3.0mm & Flat Cable)</p> <table><tr><td>Cable</td><td>Tube</td></tr><tr><td>250/900um</td><td>0.9</td></tr><tr><td>2.0mm</td><td>2.0</td></tr></table>	Cable	Tube	250/900um	0.9	2.0mm	2.0		<p>Step 6 Take off "Release Key". Press both buttons on the body during the fiber is curving.</p> <p>*Make sure to push buttons to the end.</p>
Cable	Tube								
250/900um	0.9								
2.0mm	2.0								
<p>A. 2.0 mm/ 3.0 mm/ Flat Cable</p>  <p>B. 250/900um</p> 	<p>< Drawing ></p> <p>Stripping and Cleaving length for different Fibers.</p>		<p>Step 7 Take off from Fiber checker and wear dust cap.</p> <p>(Skip this if no Fiber Checker.)</p>						
	<p>Step 3 After stripping fiber, please cleave the fiber as the length above.</p>		<p>Step 8 Wear boot and housing. Now the job is done.</p>						

Quick Assembly Connector (No Tool) – 250um/900um**User's Manual**

Rev. 2011B

B. Release Methods

	< Method A > Use nail to release the buttons.		< Method B > Use "Release Key" to unlock the buttons. *The key is free to customers.
---	---	--	---

C. Contact Information

If you have any question for our products, please contact us. You can also find the "Training Video" on our web.

BroField Technology Inc.**NO, 6, LN 40, SEC 1. CHU-MEI RD, CHUTUNG,****HSINCHU, 310 TAIWAN****E-mail: info@brofield.com****Web: www.brofield.com****TEL +886-3-5833517****FAX +886-3-5827018**

BroField Technology Inc.

6, Ln 40, Sec 1, Chu-Mei Road, ChuTung, HsinChu 310, Taiwan TEL +886-3-5833517 FAX +886-3-5827018

www.brofield.com info@brofield.com*Made in Taiwan*